

Lone Mountain Aircraft Maintenance

2460 Greentree Road
 Hangar 12
 Lebanon, Ohio 45036
 Phone: 888-566-3686
 Date: 4/25/2019

CUSTOMER INFORMATION
Imagine Air Jet Services Llc 3740 Davinci Ct Ste 420 Norcross, GA 300927619 Reg. No: N106TQ 2007 Cirrus Design Corp Sr22 Current A/C TT: 4814.2, Tach: 4096.5 A/C Serial: 2633

Customer Invoice Work Order: 1899-04-2019
--

Item: 1 - Airworthy Airframe

Discrepancy	Hours	Subtotal
Airframe Annual Inspection	25.00	2,450.00

Corrective Action

Complied with the Airframe Annual Inspection according to the Manufacturers Maintenance Manual. Serviced all wheel bearings. Serviced fuel gaskolator. Comply with FAR 91.207 ELT inspection. Inspected fire bottle. Serviced hydraulic fluid. Serviced tire pressures. Serviced #1 ship battery. Serviced #2 ship battery. Researched SB's and complied with all applicable ADs.

Labor: \$2,450.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$2,450.00
--------------------------	----------------------	-------------------------	----------------------------------

Item: 2 - Airworthy Engine

Discrepancy	Hours	Subtotal
Engine Annual Inspection	N/C	0.00

Corrective Action

Complied with the Engine Annual Inspection in accordance with the Manufacturers Maintenance Manual. Megged all ignition leads. Serviced engine with Phillips 20W50M oil. Mineral oil should be replaced with normal detergent oil after 25 hour break in of newly installed cylinder.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
9	EA	20w50 Mineral oil	Phillips oil Mineral		8.25	74.25

Labor: \$0.00	Parts: \$74.25	Shipping: \$8.53	Item Subtotal: \$82.78
----------------------	-----------------------	-------------------------	-------------------------------

Item: 3 - Airworthy Prop

Discrepancy	Hours	Subtotal
Propeller Annual Inspection	N/C	0.00

Corrective Action

Complied with the Propeller annual inspection in accordance with the manufacturers maintenance manual. Serviced hub with Aeroshell #6 grease.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 4 - Airworthy Airframe

Discrepancy	Hours	Subtotal
#1 Battery low and will not hold a charge.	N/C	0.00

Corrective Action

#1 Battery removed and replaced with new RG-24M S/N 40986334 Concorde Battery.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 5 - Airworthy Airframe

Discrepancy	Hours	Subtotal
Line Cutters Due 6 year replacement interval.	1.50	147.00

Corrective Action

Removed and replaced Line Cutters, Line Cutters installed S/N 14946 & 14985. Line Cutters next due replacement 02/2025. C/W SB2X-95-12 Line Cutter Rigging Illustration Error.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1	EA	25347-002	Line cutter kit (P/O: 1483)		1,198.00	1,198.00

Labor: \$147.00	Parts: \$1,198.00	Shipping: \$75.98	Item Subtotal: \$1,420.98
------------------------	--------------------------	--------------------------	----------------------------------

Item: 6 - Airworthy Engine

Discrepancy	Hours	Subtotal
All Spark Plugs at or nearing serviceable limits.	N/C	0.00

Corrective Action

Removed and replaced all Spark Plugs with new Tempest URHB32E Plugs.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
8	EA	URHB32E	Tempest Spark Plug (P/O: 1416)		40.50	324.00
4	EA	URHB32E	Tempest Spark Plug (P/O: 1460)		40.50	162.00

Labor: \$0.00	Parts: \$486.00	Shipping: \$10.63	Item Subtotal: \$496.63
----------------------	------------------------	--------------------------	--------------------------------

Item: 7 - Airworthy Airframe

Discrepancy	Hours	Subtotal
Exhaust slip joints are froze and need Anti Seize applied.	0.50	49.00

Corrective Action

Applied Anti Seize to all slip joints.

Labor: \$49.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$49.00
-----------------------	----------------------	-------------------------	-------------------------------

Item: 8 - Airworthy Airframe

Discrepancy	Hours	Subtotal
L/H Flap atch fitting needs torqued to flap cross over tube.	0.50	49.00

Corrective Action

Torqued fitting for L/H Flap on Flap cross over tube.

Labor: \$49.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$49.00
-----------------------	----------------------	-------------------------	-------------------------------

Item: 9 - Airworthy Prop

Discrepancy	Hours	Subtotal
Propeller Blades leading edges are nicked and need dressed.	0.75	73.50

Corrective Action

Dressed all Propeller blades as required.

Labor: \$73.50	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$73.50
-----------------------	----------------------	-------------------------	-------------------------------

Item: 10 - Airworthy Engine

Discrepancy	Hours	Subtotal
Compression check and borescope inspection required.	N/C	0.00

Corrective Action

Compression check is as follows; #1-66, #2-54, #3-56, #4-61, #5-62, #6-68. Master Orifice 46/80. Borecope inspection revealed #6 has had a valve strike.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 11 - Airworthy Engine

Discrepancy	Hours	Subtotal
#6 Cylinder piston has had a valve strike.	10.00	980.00

Corrective Action

Removed and replaced #6 Cylinder with Overhauled Cylinder P/N 655932 S/N ACO5JB041. Cylinder was Overhauled by Signature Engines WO# E7822. Ran Engine and checked for leaks--no leaks noted at this time.

Outside Repair:
 Labor: 0.00, Parts: 1,200.00

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1	EA	649950	Gasket intake (P/O: 0518)		1.40	1.40

3 EA	652458	Exhaust gasket (no blow) (P/O: 1485)	7.23	21.69
Labor: \$980.00		Parts: \$1,223.09	Shipping: \$56.36	Item Subtotal: \$2,259.45

Item: 12 - Airframe Recommended

Discrepancy	Hours	Subtotal
Air Conditioner appears to be leaking oil from the receiver dryer assembler.	N/C	0.00
Corrective Action		
This item deferred.		

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 13 - Airframe Recommended

Discrepancy	Hours	Subtotal
TKS Leak under pump at rear passenger left hand seat area.	N/C	0.00
Corrective Action		
This item deferred.		

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 14 - Airframe Recommended

Discrepancy	Hours	Subtotal
L/H rear passenger seat missing retaining pin.	N/C	0.00
Corrective Action		
This item deferred.		

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 15 - Airframe Recommended

Discrepancy	Hours	Subtotal
STec 55X Autopilot does not work and circuit breaker for autopilot pops upon power up.	N/C	0.00
Corrective Action		
This item deferred.		

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 16 - Airframe Recommended

Discrepancy	Hours	Subtotal
Lower L/H cowling has a 4" crack at NLG strut pass through area.	N/C	0.00
Corrective Action		
This item deferred.		

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 17 - Airframe Recommended

Discrepancy	Hours	Subtotal
Landing light lens is cloudy and distorts how bright the light is shining through it.	N/C	0.00
Corrective Action		
This item deferred.		

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 18 - Airframe Recommended

Discrepancy	Hours	Subtotal
All Engine Cowlings are gouged and worn at prop hub.	N/C	0.00
Corrective Action		
This item deferred.		

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00
----------------------	----------------------	-------------------------	-----------------------	--------

Item: 19 - Airframe Recommended

Discrepancy	Hours	Subtotal
Water stain on rear headliner at rear upper window area.	N/C	0.00

Corrective Action
 This item deferred.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00
----------------------	----------------------	-------------------------	-----------------------	--------

Item: 20 - Airframe Recommended

Discrepancy	Hours	Subtotal
FWD and AFT well nuts for baggage door threshold require replacement.	N/C	0.00

Corrective Action
 This item deferred.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00
----------------------	----------------------	-------------------------	-----------------------	--------

Item: 21 - Airframe Recommended

Discrepancy	Hours	Subtotal
R/H Elevator tip has a sealant patch, unknown as to what it is covering.	N/C	0.00

Corrective Action
 This item deferred.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00
----------------------	----------------------	-------------------------	-----------------------	--------

Item: 22 - Airframe Recommended

Discrepancy	Hours	Subtotal
NLG Pucks are dry rotted and weather cracked.	N/C	0.00

Corrective Action
 This item deferred.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00
----------------------	----------------------	-------------------------	-----------------------	--------

Item: 23 - Airframe Recommended

Discrepancy	Hours	Subtotal
All windows appear to need resealed.	N/C	0.00

Corrective Action
 This item deferred.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00
----------------------	----------------------	-------------------------	-----------------------	--------

Item: 24 - Airframe Recommended

Discrepancy	Hours	Subtotal
NLG Rebound bumper deteriorated.	N/C	0.00

Corrective Action
 This item deferred.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00
----------------------	----------------------	-------------------------	-----------------------	--------

Item: 25 - Airframe Recommended

Discrepancy	Hours	Subtotal
430's have very sticky and hard to press keys.	N/C	0.00

Corrective Action
 This item deferred.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00
----------------------	----------------------	-------------------------	-----------------------	--------

Item: 26 - Advisory

Discrepancy	Hours	Subtotal
#2 Batteries due replacement 10/2019.	N/C	0.00

Corrective Action
Advisory only.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00
----------------------	----------------------	-------------------------	-----------------------	--------

Item: 27 - Advisory

Discrepancy	Hours	Subtotal
Remote ELT battery due replacement 08/2019	N/C	0.00

Corrective Action
Advisory only.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00
----------------------	----------------------	-------------------------	-----------------------	--------

Item: 28 - Advisory

Discrepancy	Hours	Subtotal
TKS Filter due replacement 12/2019.	N/C	0.00

Corrective Action
Advisory only.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00
----------------------	----------------------	-------------------------	-----------------------	--------

Item: 29 - Advisory

Discrepancy	Hours	Subtotal
L/H and R/H Seat Inflators due replacement 05/2019.	N/C	0.00

Corrective Action
Advisory only.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00
----------------------	----------------------	-------------------------	-----------------------	--------

Item: 30 - Advisory

Discrepancy	Hours	Subtotal
Pitot Static and Transponder 24 month due 09/2019.	N/C	0.00

Corrective Action
Advisory only.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00
----------------------	----------------------	-------------------------	-----------------------	--------

Please see the next page for the totals for this invoice

Additional Charges							
Pilot Services	Tire Disposal	EPA Charge	Oil Analysis	Shop Supplies	Fuel	Misc.	Subtotal
1,000.00	0.00	0.00	0.00	93.71	511.75	4,889.55	\$6,495.01

Labor Summary	
Shop Labor: \$3,748.50	Outside Repair: \$0.00

The estimated total was \$9,534.14

Total Labor:	\$3,748.50
Total Parts:	\$2,981.34
Total Shipping:	\$151.50
Additional Charges:	\$6,495.01
Tax:	\$0.00
Amount Due:	\$13,376.35
Deposits & Credits:	\$6,500.00
Balance Due:	\$6,876.35

Important Information

MISC. CHARGES NOTES:

3 Technicians \$400.00 a day travel to N.C. and back to OH total \$2,400.00. \$907.55 Hotel expenses. \$150.00 Hangar fee at Kinston Airport. \$928.00 Mileage. 3 Techicians \$58 day Per Diem times 3 days \$504.00.

Imagine Air Jet Services Llc or Authorized Representative

Date