



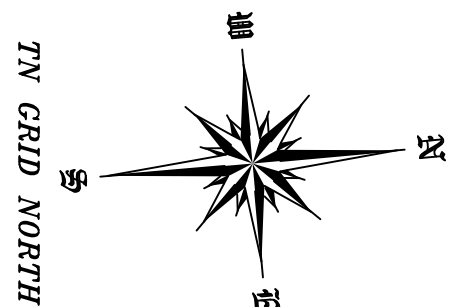

TN GRID NORTH

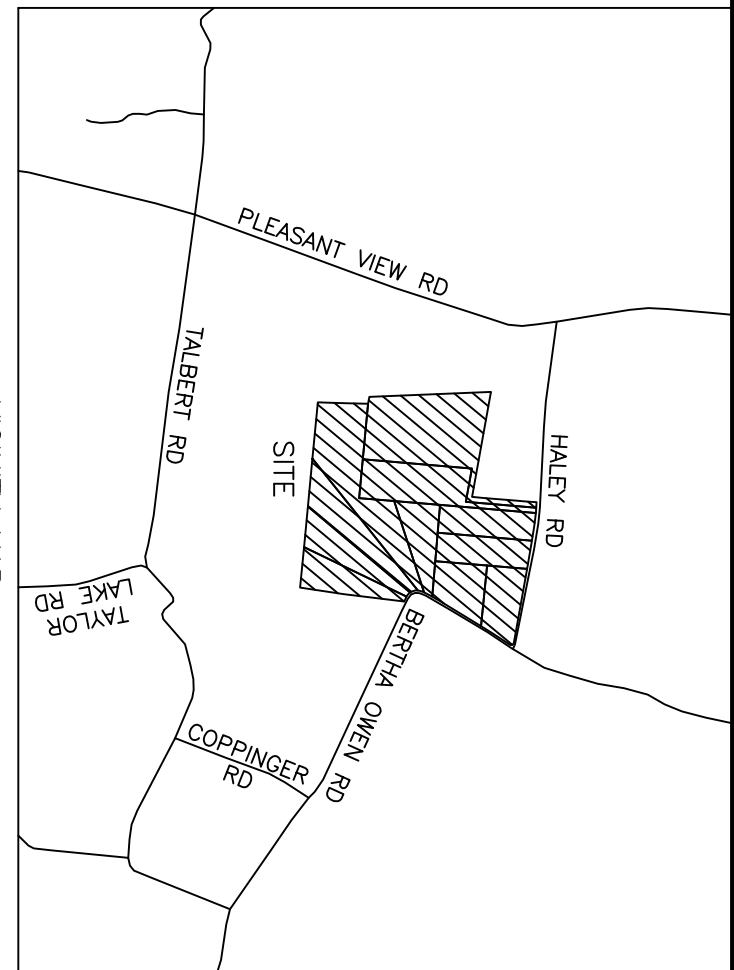

VICINITY MAP
NOT TO SCALE


CURVE	RADIUS	ARC LENGTH	CHORD LENGTH	CHORD BEARING	DELTA ANGLE
C1	1825.02'	233.92'	S 233.92° E	S 82°15'21" E	172°03'58"
C2	1825.02'	50.01'	S 50.01° E	S 82°15'21" E	134°14'12"
C3	1825.02'	50.01'	S 50.01° E	S 82°28'13" E	134°14'12"
C4	1825.02'	130.64'	S 130.64' W	N 81°38'05" W	4°06'05"
C5	25.00'	49.40'	S 49.40' W	S 21°50'21" E	113°13'35"
C6	630.56'	89.54'	S 89.54' W	S 26°34'29" W	8°02'42"
C7	630.56'	89.54'	S 89.54' W	S 33°17'33" W	6°03'42"
C8	630.56'	89.54'	S 89.54' W	S 33°17'33" W	6°03'42"
C9	110.05'	165.46'	S 165.46' E	S 21°01'11" E	86°08'38"
C10	110.05'	29.24'	S 29.24' W	S 14°18'36" W	15°29'03"
C11	110.05'	77.31'	S 77.31' E	S 13°53'20" E	40°14'50"
C12	110.05'	56.42'	S 56.42' E	S 48°53'08" E	50°24'46"
C13	110.05'	53.82'	S 53.82' W	N 68°59'18" W	2°52'29"

LINE	BEARING	LENGTH	POINT
1	S 21°50'21" E	130.64'	1
2	S 26°34'29" W	89.54'	2
3	S 33°17'33" W	89.54'	3
4	S 33°17'33" W	89.54'	4
5	S 21°01'11" E	165.46'	5
6	S 14°18'36" W	29.24'	6
7	S 13°53'20" E	77.31'	7
8	S 48°53'08" E	56.42'	8
9	N 68°59'18" W	53.82'	9

LEGEND

- 5/8" CAPPED REBAR (NEW) RLS # 2712
- △ MONUMENT NEITHER SET NOR FOUND
- ◆ 1/2" CAPPED REBAR (OLD) RLS # 365
- 3/8" CAPPED REBAR (OLD) RLS # 317
- ⊗ 5/8" UNCAPPED REBAR (OLD)
- ⊗ 1/2" UNCAPPED REBAR (OLD)
- ⊗ 3/8" UNCAPPED REBAR (OLD)
- WOOD POST (OLD)
- ▲ CONTROL POINT
- E — OVERHEAD ELECTRIC
- - - PROPERTY BOUNDARY

NOTE: This survey was performed with RTK GPS positional data, based on the Tennessee State Plane NAD 83 datum. The coordinates of the control point shown were derived using a VRS network of CORS stations projected to TN SPC83. Datum: NAD 83; Geoid: ContinentalUS_NG52018. The positional accuracy of the GPS vectors does not exceed H: 8 mm + 0.999990340 centered upon the control point shown herein.

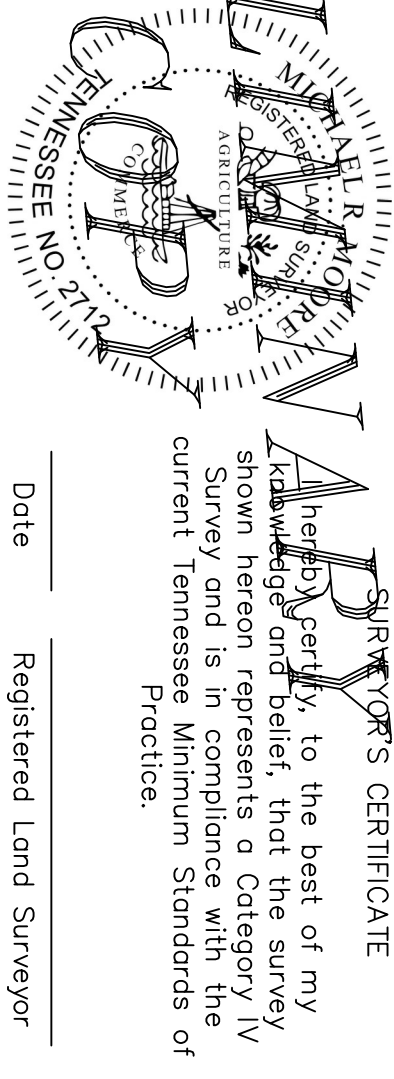

Date _____ Registered Land Surveyor

LARRY BRANDON	
DRAWN BY	DATE
EHJ	7/15/25
RB 251 - P 323	
TAX ID: 079 009.00	
5th Civil District	
SCALE	ACREAGE
1" = 100'	85.12 AC. ±

MOORE
LAND SURVEYERS
208 N. CHANCEY ST.
MCMINNVILLE, TN
931.473.1088
MICHAEL@
MOORELANDSURVEYS.COM

